



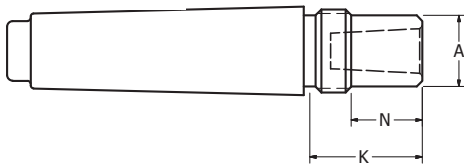

Quick Point Dead Centers, Sets and Replacement Points

- Accuracy guaranteed to $\pm .0002$.
- Interchangeable points reduce the need for several centers.
- Purchase individual replacement points or a complete set.
- Special points are available upon request.
- Mounting taper of points is 1:10.
- Safe storage container provided with a complete set.
- Point extractor for easy removal of points is included in the set or can be purchased separately.

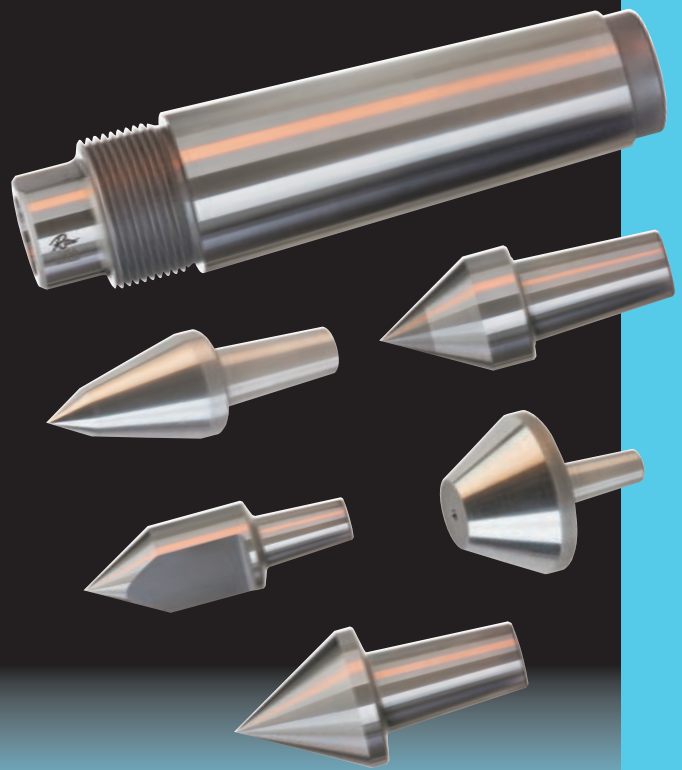

A Quick Point Set includes: a dead center, a tracer point, a bull nose point, a carbide tip point, a male point, a half point, and a point extractor.


QUICK POINT SETS

Model	Taper
68303	3
68304	4
68305	5




POINT EXTRACTORS


Model	Taper
49904	3, 4
49905	5




T - Tracer Point

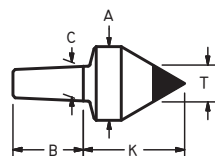

CT - Carbide Tip Male Point

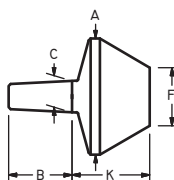

BN - Bull Nose Point

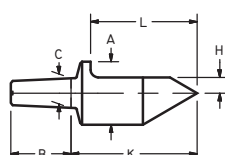

HP - Half Point

CNC DEAD CENTER

Model	MT	A	N	K	Threads	Nut
68323	3	0.75	0.75	1.19	7/8 - 14	81031
68324	4	1.00	0.75	1.44	1 1/8 - 12	81041
68325	5	1.25	0.74	1.62	1 5/8 - 12	81051
68384*	4	1.25	0.75	1.94	1 3/8 - 12	86041
68385*	5	1.75	0.75	2.24	1 7/8 - 12	86051

* Special taper for Mazak machines

Other tapers available upon request

QUICK POINTS

Model	MT	Style	A	F	K	C	B	T	H	L
91033	3	T	0.38	-	1.30	0.47	0.96	-	-	-
91034	3	BN	1.75	0.88	1.17	0.47	0.96	-	-	-
91035	3	CT	1.00	-	1.38	0.47	0.96	0.50	-	-
91036	3	HP	1.00	-	2.00	0.47	0.96	-	0.25	1.69
91043	4	T	0.50	-	1.80	0.59	1.20	-	-	-
91044	4	BN	2.25	1.00	1.55	0.59	1.20	-	-	-
91045	4	CT	1.00	-	1.38	0.59	1.20	0.50	-	-
91046	4	HP	1.13	-	2.55	0.59	1.20	-	0.25	2.25
91053	5	T	0.50	-	2.12	0.87	1.44	-	-	-
91054	5	BN	2.75	1.50	1.58	0.87	1.44	-	-	-
91055	5	CT	1.25	-	1.69	0.87	1.44	0.63	-	-
91056	5	HP	1.50	-	3.06	0.87	1.44	-	0.38	2.75

For male and female points, see page 9.